

TECHNICAL SERVICE BULLETIN

NO.



Triumph

January, 1976

SUBJECT:


COOLANT LOSS

MODELS:

TR7

It is of particular importance during the pre-delivery service on the Triumph TR7 that all water hose connections are thoroughly tightened so as to prevent coolant loss.

There is one hose connection located directly underneath the induction manifold (refer to diagram), which conceivably could be overlooked because of its location. Access to this hose is gained by reaching with a long screwdriver from the right hand side of the engine underneath the carburettors.

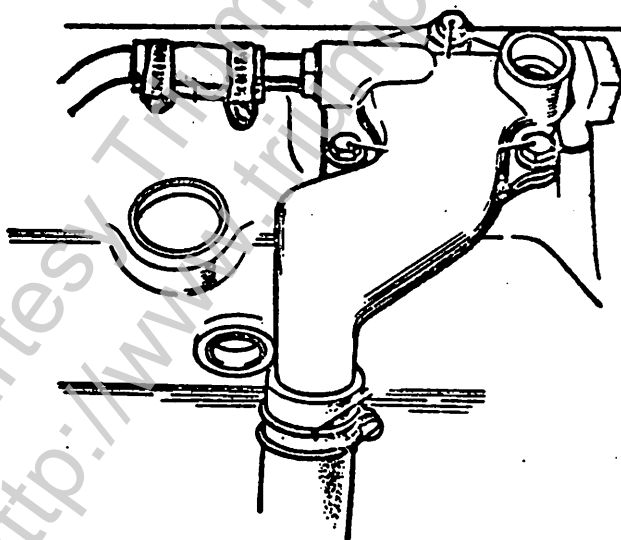

J.P.