

SERVICE & PARTS TECHNICAL INFORMATION

79-A-2



Triumph

April, 1979

SUBJECT:

CYLINDER HEAD GASKETS

MODELS:

TR7


When replacing TR7 cylinder head gaskets it is essential to USE ONLY gasket, part no. GEG 3304.

It is also essential that prior to engine no. CV 10330, the cylinder head bolts, nuts, studs and washers be replaced with the parts supplied in Bolt/Nut Kit, part no. RTC 2375.

The old TR7 cylinder head gasket, part no. GEG 384, and decarb set, part no. GEG 1190, must NOT be used. Parts department will be instructed to return any stocks of genuine gaskets, part no. GEG 384 and GEG 1190, purchased from Jaguar Rover Triumph Inc., to the zone or distributor.

The following torque and cylinder head tightening sequence must be used when fitting cylinder head gasket, part no. GEG 3304.

TORQUE 45-50 lbs/ft.

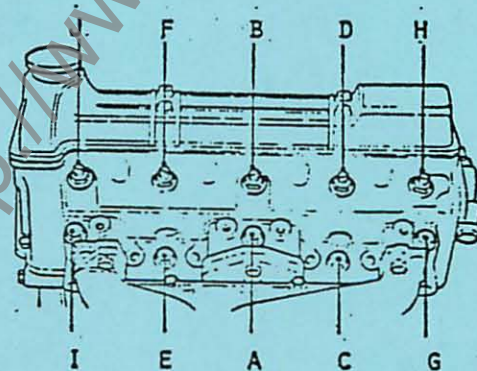

P.W.B./H.C.T.